# **DATA SHEET**

# CO<sub>2</sub> Sensors

# Robust Range—ExplorIR®-M



- Low power / energy consumption—3.5mW
- Measures up to 100% CO<sub>2</sub> concentration
- Miniature format; vibration and shock resistant
- Solid-state; no moving parts, no heated filaments
- Digital (UART) output
- > 15 years lifetime





Supply Voltage



Power Consumption



Operating Temp





Output Digital



Response Time





- Reliable in harsh, volatile environments
- Ideal for low power and battery applications
- Up to 50X lower power than typical NDIR CO<sub>2</sub> sensors
- Low maintenance
- Suitable for wireless, portable, wearable and self-powered systems

#### **✓** CO₂ MEASUREMENT SPECIFICATIONS

Sensing method Non-dispersive infrared (NDIR)

Sample method Diffusion

Measurement range 0—5%, 0—20%, 0—100% Accuracy<sup>d</sup> ± (70ppm+5% of reading)

(100% range ± (300ppm+

5% of reading<sup>b</sup>)

absorption

Pressure dependence 0.15% of reading per mbar in

normal atmospheric conditions

Operating pressure range<sup>f</sup> 500mbar to 2bar

Response time, T90<sup>g</sup> 10sec—2mins (configurable via

filter and application)+

Reading refreshed twice per sec.

### TECHNICAL SPECIFICATIONS

Supply voltage 3.25—5.5V<sub>DC</sub>

(3.3V recommended) Peak Current 33mA

Average Current <1.5mA

Power consumption<sup>a</sup> 3.5mW

Output type 3.3V TTL level UART

Temperature

Current<sup>a</sup>

Operating: 0°C to +50°C (standard) -25°C to +55°C (extended)

Storage: -30°C to +70°C

Humidity<sup>b</sup> 0—95% Rh, non-condensing

Start-up time<sup>c</sup> 1.2

Connector 4 x 0.5mm sq pins

Need help? Ask the expert Tel: + 44 (0)1236 459 020

and ask for "Technical"






- (a) Power measurements for standard CO<sub>2</sub> sensor with 2 readings per second. Temperature and RH% measurements increase power consumption.
- b) For extended operation in high temperature and humidity environments, contact SST.
- Time to a valid reading is determined by digital filter setting; typically 4-8 seconds.
  All measurements are at NTP unless otherwise stated.
- e) Calibrated for 1013mbar. SST can supply advanced pressure correction advice when operating outside normal atmospheric conditions.
- f) External pressure calibration required.
- g) Response time to a step change in gas level is dependent on application/filter/flow rate/diffusion

## Ħ


#### **OUTLINE DRAWING & ELECTRICAL CONNECTIONS**

Pin	Designation
0V	GND
V+	3.3V to 5V
Tx OUT	UART Tx from sensor V <sub>oh</sub> = 3V
Rx IN	UART Rx to sensor used for configuration

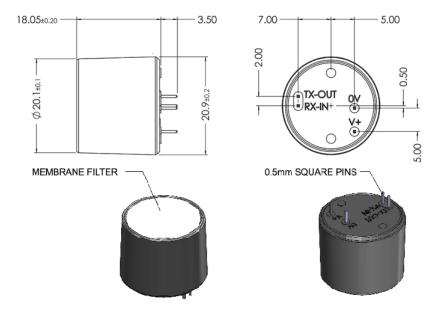



Generate your specific part number using the convention shown opposite. Use only the numbers that correspond to the sensor option you require — omit those you do not.

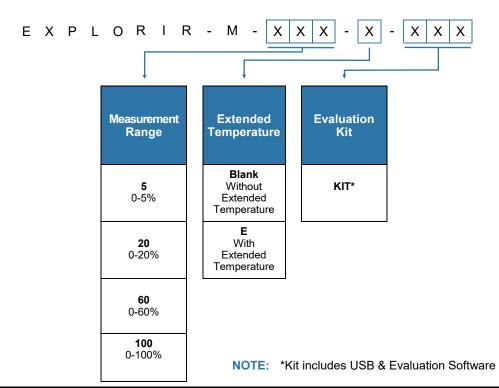



Do not exceed maximum ratings and ensure sensor(s) are operated in accordance with their requirements.

Carefully follow all wiring instructions. Incorrect wiring can cause permanent damage to the device.

Do NOT use chemical cleaning agents.

Failure to comply with these instructions may result in product damage.

### **1** INFORMATION

As customer applications are outside of SST Sensing Ltd.'s control, the information provided is given without legal responsibility. Customers should test under their own conditions to ensure that the equipment is suitable for their intended application.

For technical assistance or advice, please email: technical@sstsensing.com

General Note: SST Sensing Ltd. reserves the right to make changes to product specifications without notice or liability. All information is subject to SST Sensing Ltd.'s own data and considered accurate at time of going to print.

RoHS

